


Bushing

To be used for insulating leads. Wet-form molding by hands.

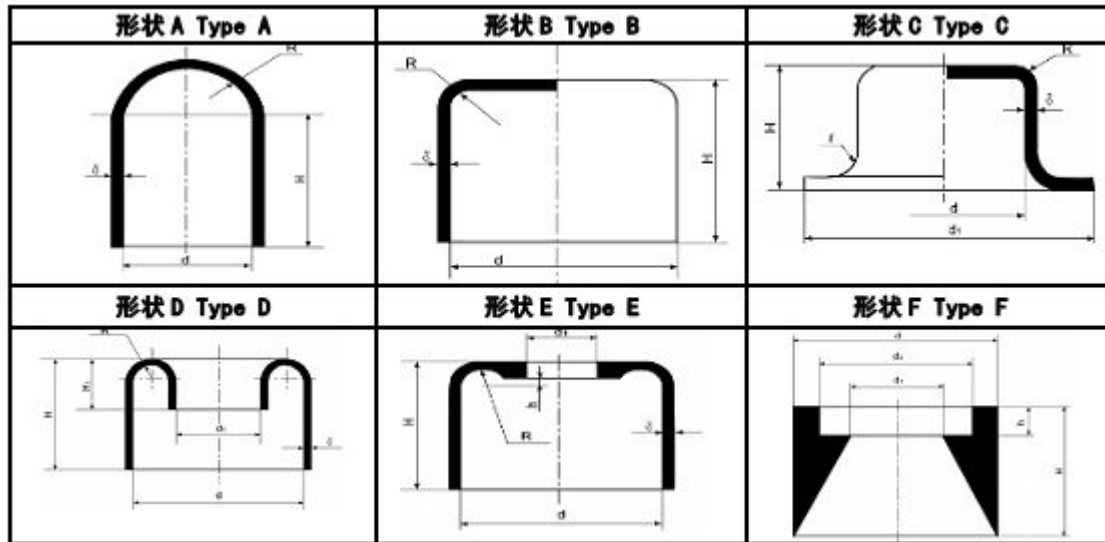

Tolerances

| 尺寸 Dimensions | d | d1 | d2 | H | | H1 | h | δ | | R | r |
|---------------|---------|---------|---------|--------|-----|-----|-----|-----|------|-----|-----|
| 偏差 Tolerance | +3 0 | +3 0 | +2 0 | < 50 | ± 1 | ± 5 | ± 2 | < 3 | +1.5 | ± 2 | +10 |
| | | | | 50-200 | ± 2 | | | | 0 | | |
| | | | | > 200 | ± 5 | | | | +2 | | |

Dimensions of molds

| 尺寸 Dimensions | d | d1 | d2 | H | H1 | h | δ | R | r |
|---------------|-----|----|----|-----|----|---|---|----|---|
| 形状 A Type A | 56 | | | 120 | | | 3 | 28 | |
| 形状 B Type B | 94 | | | 140 | | | 5 | 5 | |
| | 70 | | | 140 | | | 5 | 5 | |
| | 114 | | | 180 | | | 4 | 5 | |
| 形状 C Type C | 52 | 95 | | 30 | | | 4 | 9 | 5 |
| 形状 D Type D | 90 | 60 | | 170 | 40 | | 4 | 6 | |
| | 52 | 28 | | 200 | 40 | | 4 | 3 | |
| | 115 | 65 | | 100 | 40 | | 4 | 10 | |
| | 74 | 44 | | 100 | 40 | | 4 | 5 | |
| 形状 E Type E | 30 | 71 | | 80 | | 5 | 6 | 8 | |
| 形状 F Type F | 58 | 36 | 50 | 50 | 10 | | | | |